


# Installing a New Printhead in Your KODAK 5000 Series All-in-One Printer


1




**a)** Follow these instructions for step-by-step guidance on how to remove and replace your printhead.

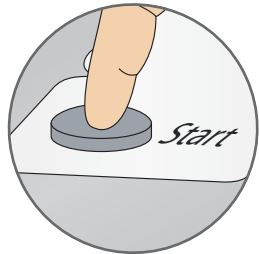

**b)** If your printer is not powered on, press Start.

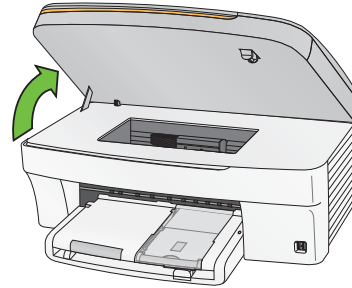


**c)** Lift the printer access door and wait for the carriage to move to the access position.

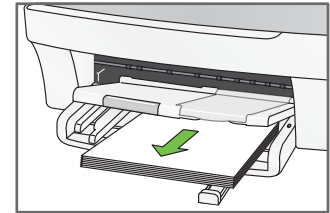


**d)** Remove any paper that may be loaded in the printer.

2


## Remove Ink Cartridges and Used Printhead

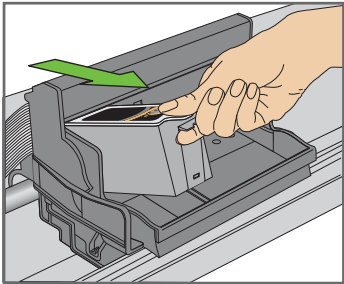

**a)** Remove both ink cartridges and set them aside.

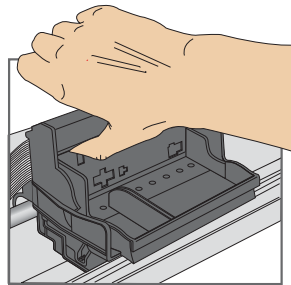


**b)** Unlatch the used printhead. Press the button on the left, as shown.

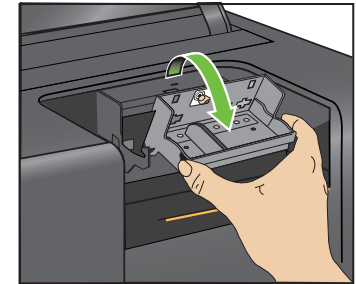


**c)** Lift the used printhead out of the carriage.

# 3


## Insert New Printhead

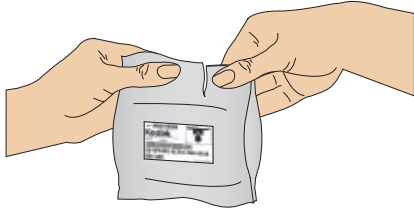


- a) Remove the printhead from its bag.  
**IMPORTANT:** Complete steps b through d immediately after opening sealed bag.

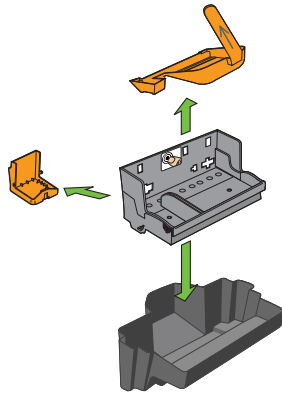

- b) Remove the 3 plastic protective shields.

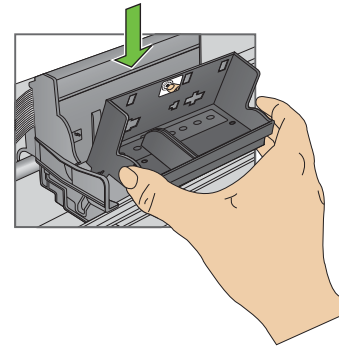


- c) Place the printhead into the carriage. Insert at the angle shown.

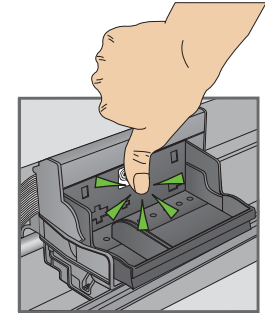


- d) Push **firmly** against the back wall of the printhead until you hear a loud snap.

# 4


## Re-Insert the Ink Cartridges

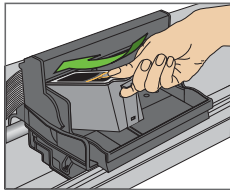

- a) Insert the black ink cartridge into the printhead.

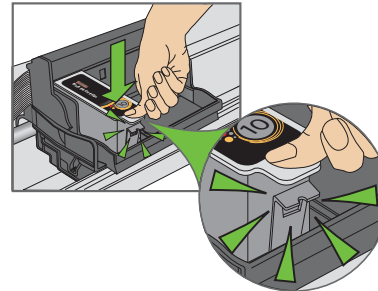


- b) Press down on the ink cartridge until you hear it click into position.

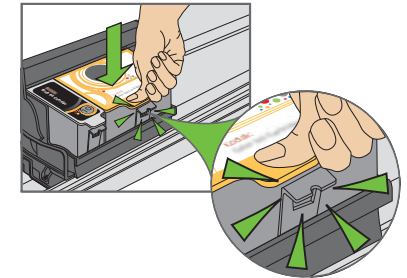


- c) Repeat steps 4a-4b for the color ink cartridge. Close the printer access door.

# 5


## Load Paper and Calibrate

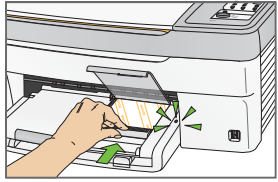

**a)** Insert 4x6 photo paper glossy side down and push the photo tray in until it clicks into place. The photo tray light should illuminate when the tray is properly inserted.

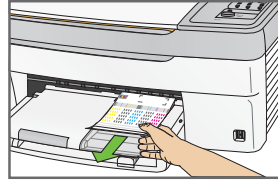


**b)** Once the ON/OFF indicator is a steady Green, press Start and allow the printer to print a calibration sheet.

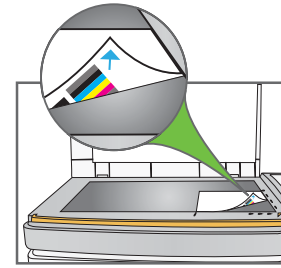

5100/5300

**c)** Remove the calibration sheet from the output tray. Place it face down and align to the registration marks in the proper corner of the scanner glass, **as shown**.

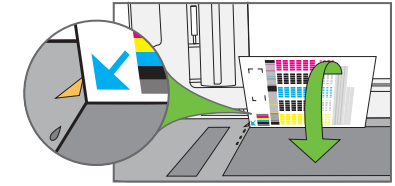

5500

**d)** Lower the scanner lid and press Start. Wait 2 to 3 minutes for the calibration sheet to print.

## Need More Help?

For printer support, please go to [www.kodak.com/go/aiosupport](http://www.kodak.com/go/aiosupport) or [www.kodak.com/go/contact](http://www.kodak.com/go/contact).